



**3 GROMMET
PACKING GLAND
3/4" STRAIGHT
7017-20031-2G-037
NOMINAL CABLE
O.D. 0.370**

GLAND PACKING INSTRUCTIONS

GROMMET PACKING MATERIAL

1. INSERT NUT OVER CABLE.
2. INSERT TUBE (IF USED) OVER CABLE.
3. INSERT ONE BUSHING OVER CABLE.
4. INSERT THREE GROMMET OVER CABLE.
5. INSERT ONE BUSHING IN STUFFING BOX.
6. INSERT END OF CABLE THRU BUSHING & STUFFING BOX.
7. INSERT GROMMET AND OUTER BUSHING INTO STUFFING BOX AND TIGHTEN NUT SECURELY.
8. WHEN NUT IS TIGHTENED THERE MUST STILL BE 1/8" MIN. LEFT TO TRAVEL WITHOUT MEETING INTERFERENCE FROM ANYTHING EXCEPT GROMMET.

NOTE: DO NOT REUSE GROMMETS AFTER BEING COMPRESSED ALWAYS USE NEW GROMMETS.